Assembly Instructions
Teacup Pendant # PXX166

WARNING: BE SURE TO SHUT OFF POWER AT THE MAIN FUSE OR CIRCUIT BREAKER BOX BEFORE INSTALLING OR SERVICING THIS FIXTURE.

NOTE: 1. Before installing, consult local electrical codes for wiring requirements.
2. Read and save this instruction.

1. Thread the cord through the porcelain plate, canopy and strain relief. Measure the desired length of the cord (A) from the canopy to the top end of the porcelain housing and leave an additional 9" of cord (B) above the canopy (include the canopy). Then cut off the unnecessary cord. (See Fig.1)
2. Adjust strain relief a 9" position from the top of the cord.
3. Mark the 3" of cord (C) from the top of the cord (B). Use a knife to peel off the insulation of the cord (C) carefully to expose the 3 wires on the inside. (See Fig.1)
   Caution: Cutting too deep may cut off the three inside wires and destroy the insulation surface of the three inside wires.

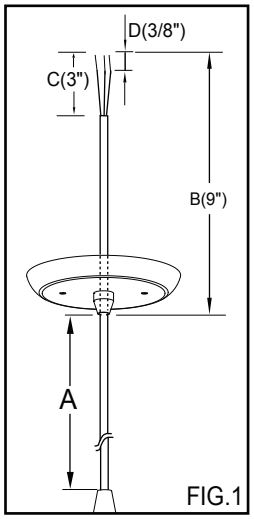

FIG.1

4. Peel off the 3 wires from the top about 3/8" long(D) to expose the copper for wiring.
5. Thread two screws through the holes of the cross bar, then secure them with two lock nuts. Adjust the length of the screws if necessary.
6. Mount cross bar securely to outlet box with 2 mounting screws through the slot in the cross bar.
7. Pull out the outlet wires and the house grounding wire from the outlet box. Make wire connections using the wire nuts:
   a. The black wire from the fixture to the black wire from the power source.
   b. The white wire from the fixture to the white wire from the power source.
   c. The fixture grounding wire to the house grounding wire.
   Carefully put wires back into the outlet box.
8. Pull the cord (A) down slightly until the strain relief touches the hex nut. Carefully attach the porcelain plate onto the porcelain housing.
   Note: Adjusting the strain relief can decrease or increase the length of cord that is exposed.
9. Attach the canopy to the cross bar by inserting the screws, and then secure them with two lock nuts.
10. Install a bulb (not included). See relamping label at socket area or packaging for maximum allowed wattage.
11. Turn on the power at the main fuse or circuit breaker box.